

B810 shows missing with repeater

Technical Service Note – June 21, 2013

Effects the following products

- B810
- GV4 Control Panels
- B Series Control Panels

1 | Issue

RADION wireless by Bosch RFRP-A repeaters installed with a B810 wireless receiver with firmware v1.xx might show a missing status for the B810 if no repeater is programmed as Module 8.

When this issue occurs, the control panel reports the B810 and all devices programmed for use with the module as missing.

2 | Resolution

When adding one or more repeaters to the system, program at least one of the repeaters as Module 8 to eliminate the false missing report.

Refer to the following figure:

| Wireless Repeater | Enclosure Tamper | RFID |
|-------------------|------------------|----------|
| Module 1 | No | 0 |
| Module 2 | No | 0 |
| Module 3 | No | 0 |
| Module 4 | No | 0 |
| Module 5 | No | 0 |
| Module 6 | No | 0 |
| Module 7 | No | 0 |
| Module 8 | No | 12345678 |

Figure 2.1: Programming a repeater for Module 8 example



NOTICE!

The issue described in this Technical Service Note does not occur with B810 modules with firmware v2.0 or higher.

Copyright

This document is the intellectual property of Bosch Security Systems, Inc. and is protected by copyright. All rights reserved.

Trademarks

All hardware and software product names used in this document are likely to be registered trademarks and must be treated accordingly.

Bosch Security Systems, Inc. product manufacturing dates

Use the serial number located on the product label and refer to the Bosch Security Systems, Inc. website at <http://www.boschsecurity.com/datecodes/>.



RADION receiver SD
B810



en Technical Service Note

Bosch Security Systems, Inc.
130 Perinton Parkway
Fairport, NY 14450
USA

www.boschsecurity.us

