

# **PRAESENSA**

Public Address and Voice Alarm System



# Table of contents

|          |   |           |
|----------|---|-----------|
| <b>1</b> | <b>Introduction</b>   | <b>5</b>  |
| 1.1      | Release history   | 5         |
| 1.2      | Scope   | 5         |
| 1.3      | Installation and configuration information                        | 5         |
| 1.4      | Use latest software   | 6         |
| <b>2</b> | <b>Supported products and compliance to voice alarm standards</b> | <b>7</b>  |
| <b>3</b> | <b>Added functionalities</b>                                      | <b>9</b>  |
| 3.1      | Release 2.30  | 9         |
| 3.2      | Release 2.20  | 9         |
| 3.3      | Release 2.11  | 9         |
| 3.4      | Release 2.10  | 10        |
| 3.5      | Release 2.00  | 10        |
| 3.6      | Release 1.91  | 10        |
| 3.7      | Release 1.81  | 11        |
| 3.8      | Release 1.71  | 11        |
| 3.9      | Release 1.70  | 11        |
| 3.10     | Release 1.61  | 11        |
| 3.11     | Release 1.50  | 12        |
| 3.12     | Release 1.42  | 12        |
| 3.13     | Release 1.41  | 13        |
| 3.14     | Release 1.40  | 13        |
| 3.15     | Release 1.20  | 14        |
| 3.16     | Release 1.10  | 14        |
| <b>4</b> | <b>Notices</b>  | <b>16</b> |
| 4.1      | Documentation and software download                               | 16        |
| 4.2      | Software update   | 16        |
| 4.3      | Fault event - Temperature too high                                | 16        |
| 4.4      | Load measurement  | 16        |
| 4.5      | Audio equalizer   | 16        |
| 4.6      | Minimum message length  | 16        |
| 4.7      | Logging server compatibility                                      | 16        |
| 4.8      | System controller redundancy configuration                        | 16        |
| 4.9      | Brightness adjustment   | 17        |
| 4.10     | Network snapshot  | 17        |
| 4.11     | Multi-VLAN  | 17        |
| 4.12     | Multiple redundant system controllers                             | 17        |
| 4.13     | Static IP in fail-safe mode                                       | 17        |
| 4.14     | ARNI V8.41  | 17        |
| 4.15     | License for Multi-controller functionality                        | 17        |
| <b>5</b> | <b>Known limitations</b>  | <b>18</b> |
| 5.1      | Firmware upload to call station fails                             | 18        |
| 5.2      | Dante connections   | 18        |
| 5.3      | Dante multicast   | 18        |
| 5.4      | Scheduled calls   | 18        |
| 5.5      | Load measurement  | 18        |
| 5.6      | Firmware upgrade  | 18        |
| 5.7      | Call station reset to factory default                             | 19        |
| 5.8      | Enable Network Time Protocol (NTP)                                | 19        |

---

|             |   |           |
|-------------|---|-----------|
| <b>5.9</b>  | Audio missing on systems with multiple subnets              | <b>19</b> |
| <b>5.10</b> | Dante audio outputs   | <b>19</b> |
| <b>5.11</b> | DHCP server starts later in the system                      | <b>19</b> |
| <b>5.12</b> | Sticky faults   | <b>20</b> |
| <b>5.13</b> | Multi-subnet  | <b>20</b> |
| <b>5.14</b> | Firmware upload of CST and PRA-ANS with static IP-addresses | <b>20</b> |
| <b>5.15</b> | Network snapshot exceptions                                 | <b>20</b> |
| <b>5.16</b> | Call stacking and time-shifting features                    | <b>20</b> |
| <b>5.17</b> | Limit of 4 digital audio flows for PRA-IM2A2                | <b>20</b> |
| <b>6</b>    | <b>Security precautions</b>                                 | <b>22</b> |
| <b>7</b>    | <b>Support services and Bosch Academy</b>                   | <b>24</b> |

---

# 1 Introduction

## 1.1 Release history

| Release date | Released version | Reason                      |
|--------------|------------------|-----------------------------|
| 2019-12      | 1.00             | Official release.           |
| 2020-05      | 1.10             | Official release.           |
| 2020-09      | 1.20             | Official release.           |
| 2021-02      | 1.30 and 1.31    | Specific customer releases. |
| 2021-06      | 1.40             | Official release.           |
| 2021-10      | 1.41             | Official release.           |
| 2021-12      | 1.42             | Official release.           |
| 2022-05      | 1.50             | Official release.           |
| 2022-10      | 1.60             | Internal release.           |
| 2022-11      | 1.61             | Official release.           |
| 2022-12      | 1.70             | Official release.           |
| 2023-02      | 1.71             | Official release.           |
| 2023-04      | 1.80             | Internal release.           |
| 2023-05      | 1.81             | Official release.           |
| 2023-07      | 1.90             | Internal release.           |
| 2023-08      | 1.91             | Official release.           |
| 2024-05      | 2.00             | Official release.           |
| 2024-07      | 2.10             | Official release.           |
| 2024-12      | 2.11             | Internal release.           |
| 2024-12      | 2.20             | Official release.           |
| 2025-03      | 2.30             | Official release.           |

## 1.2 Scope

The release notes give an overview of new functionality compared to the previous release. It reports known limitations and possible workarounds.

## 1.3 Installation and configuration information

PRAESENSA products are delivered with a quick installation guide (QIG) for basic step-by-step installation instructions. Detailed installation and configuration instructions are provided in the installation manual and configuration manual of PRAESENSA. Both manuals can be downloaded in different languages from [www.boschsecurity.com](http://www.boschsecurity.com) in the PRAESENSA product section.

When a PRAESENSA system is installed for voice alarm purposes, take notice of the installation and configuration directions in the checklist for compliance to the EN 54-16 and EN 54-4 standards. The checklist can be found at the end of the installation manual.

## 1.4 Use latest software

Before operating the device for the first time, make sure that you install the latest applicable release of your software version. For consistent functionality, compatibility, performance, and security, regularly update the software throughout the operational life of the device. Follow the instructions in the product documentation regarding software updates.

The following links provide more information:

- General information: <https://www.boschsecurity.com/xc/en/support/product-security/>
- Security advisories, that is a list of identified vulnerabilities and proposed solutions: <https://www.boschsecurity.com/xc/en/support/product-security/security-advisories.html>

Bosch assumes no liability whatsoever for any damage caused by operating its products with outdated software components.

## 2 Supported products and compliance to voice alarm standards

The tables show:

- The hardware and software products that can be part of a PRAESENSA system,
- The minimum required software version of PRAESENSA for each of the products, and
- For which emergency sound standards the products are certified.

Due to ongoing certification activities, the tables are subject to change.

For the latest information, check the certificates in the download section of these products in the online product catalog available at [www.boschsecurity.com](http://www.boschsecurity.com)

### PRAESENSA hardware products

| Product  | SW version | EN 54 | ISO 7240 | DNV-GL |
|--|------------|-------|----------|--------|
| PRA-PSM24  |            |       | —        |        |
| PRA-PSM48  |            | —     |          | ✓      |
| PRA-ES8P2S<br>PRA-SFPLX<br>PRA-SFPSX   | —          |       | ✓        |        |
| PRA-SCL<br>PRA-AD608<br>PRA-EOL<br>PRA-MPS3<br>PRA-CSLD<br>PRA-CSLW<br>PRA-CSE | 1.00       |       | ✓        |        |
| PRA-AD604  | 1.10       |       | ✓        |        |
| PRA-ANS  | 1.40       |       | ✓        | —      |
| PRA-CSBK<br>PRA-CSEK   | 1.41       |       | —        |        |
| OMN-ARNIE<br>OMN-ARNIS<br>IE-5000-12S12P-10G                                   | 1.50       |       | ✓        | —      |
| PRA-IM16C8<br>PRA-SCS  | 1.91       |       | ✓        | —      |
| PRA-WCP-EU<br>PRA-WCP-US   | 2.00       |       | —        |        |
| PRA-IM2A2  | 2.20       |       | ✓        | —      |

### PRAESENSA software licenses

| License   | SW version | EN 54 | DNV-GL |
|-----------|------------|-------|--------|
| PRA-LSPRA | 1.50       | ✓     | —      |
| PRA-LSCRf | 2.10       | ✓     | —      |

**PRAESENSA UL 2572-certified hardware products**

| <b>Product</b>   | <b>SW version</b> |
|--|-------------------|
| PRA-SCL<br>PRA-AD604<br>PRA-AD608<br>PRA-EOL<br>PRA-EOL-US<br>PRA-MPS3<br>PRA-CSLD<br>PRA-CSLW<br>PRA-CSE<br>PRA-ES8P2S<br>PRA-SFPLX<br>PRA-SFPSX<br>PRA-FRP3-US | 1.42              |
| PRA-IM16C8<br>PRA-SCS  | 2.11              |



## 3 Added functionalities

### 3.1 Release 2.30

- Added support for the Cisco switch IE-9320-22S4X-A.
- Extension to the call station emergency user interface. Now, besides compliance with EN 54-16, it is also compatible with the *Norme Française* (NF). When used for emergency purposes as a fireman's panel, the display shows the **Fault log** and the call progress and call status.
- Added the possibility to use an external certificate to connect to the Open interface client.
- Estonian, Latvian and Lithuanian are available as selectable languages in the user interface of the call station.

### 3.2 Release 2.20

- Added support for the new PRA-IM2A2 Audio interface module. Each device provides to the PRAESENSA system:
  - Two balanced analog audio inputs and outputs. These can be reconfigured as digital inputs and outputs to incorporate two virtual audio channels, which results in the loss of the original analog audio inputs and outputs.
  - Two configurable and supervised control inputs and voltage-free control outputs.
- Update to the *Backup* settings. Alongside the general configuration, it is now possible to back up and restore the recorded messages. The recorded messages have a size limit of 240 MB.
- Update to the *Recorded messages* settings. It is now possible to import messages in bulk to the system controller. The Recorded messages page also shows the individual size of each message and the total size of all messages.
- Update to the *Open Interface client* settings. It is now possible to prevent the Open Interface client from:
  - Starting emergency priority calls
  - Acknowledging and resetting an emergency state.
- Implementation of a new password policy. It is now possible to define
  - The minimum length of the password
  - The minimum number of digits in the password
  - The minimum number of special characters in the password.
- Fixed the issue where the call is aborted or the microphone switches off when pressing the push-to-talk button of the microphone.
- In systems with controller redundancy, a Dante output audio flow to external Dante devices now remains active even if the network connection to the duty system controller is repeatedly lost.



#### Notice!

To prevent any unexpected behavior, do not configure more than one unicast Dante flow to a PRA-IM2A2 output.

### 3.3 Release 2.11

Same added functionalities as for *Release 2.10*, page 10.

The 2.11 software release is compliant with UL 2575 and UL 864

### 3.4 Release 2.10

- Added support for the call stacking and time-shifting functions through the installation of the PRA-LSCRF License call recording and forwarding. This license allows to record calls for automatic playback to previously occupied zones. It is also possible to time-shift recorded calls, which suppresses any acoustic feedback through delayed broadcast. Record and forward up to eight calls simultaneously. Storage a maximum of 30 minutes of live speech.
- Implemented a new configuration item in the *System settings* to disable the emergency control from the Open Interface client. When enabled, this option prevents the Open Interface client from triggering emergency calls and acknowledging and resetting the emergency state. This configuration setting is mandatory for DNV-GL Type Approval in Maritime applications.

### 3.5 Release 2.00

- Added support for the new Wall control panels, PRA-WCP-EU, EU-style, and PRA-WCP-US, US-style. Each device provides convenient local control of background music (BGM) in a zone covered by a PRAESENSA sound system.
- Release of the new PRA-CSEK Call station extension kit to create dedicated, fully customized operator panels. The PRA-CSEK can take the place of two PRA-CSE, as it offers the same functionalities without the integrated switches and indicators.
- Added the possibility to download network snapshots as .txt files that show the detected and the supervised network connections.
- Implementation of a visibility button in the passwords fields of the configuration software webpages. The default is for the password to be hidden.
- Fixed a critical-severity CVSS Rating (9.8) vulnerability. The addressed fix safeguards the system against improper External Control of Critical State Data. For more details, refer to our Security Advisory BOSCH-SA- 000000-BT, published at our Security Advisory web page <https://www.boschsecurity.com/xc/en/support/product-security/security-advisories.html>.
- Fixed a high-severity CVSS Rating (8.1) vulnerability. The addressed fix safeguards the system against improper Cleartext Transmission of Sensitive Information. For more details, refer to our Security Advisory BOSCH-SA- 000000-BT, published at our Security Advisory web page <https://www.boschsecurity.com/xc/en/support/product-security/security-advisories.html>.

### 3.6 Release 1.91

- Added support for the new PRA-IM16C8 Control interface module. Each device provides 16 configurable, supervised control inputs, eight voltage-free control outputs, and two trigger outputs with connection supervision. These control inputs and outputs provide an easy and logical connection to auxiliary equipment, such as fire alarm systems.
- Added support for the new PRA-SCS System controller, small. It has all the features of the large system controller except for some limitations regarding the size of the system:
  - Control of PRAESENSA systems with a maximum of six amplifiers.
  - The number of static Dante audio streams to use as interface with 3<sup>rd</sup> party systems is limited to eight.
- Implementation of a new way to recover from a failed upgrade.

**Notice!****Do not downgrade the PRA-IM16C8 below 1.91**

While the configuration of the PRA-IM16C8 Control interface module is already available with software version 1.81, the device does not support any version below 1.91. Do not use the PRA-IM16C8 with firmware version 1.81.

**3.7****Release 1.81**

- You can configure the minimum TLS version for the open interface protocol to increase the security of the communication. By default, TLS 1.2 is disabled to enforce TLS 1.3 for the web-server.
- A firmware upgrade of the PRA-ES8P2S to version V1.01.09 solves the unplanned restarts of the PRA-ES8P2S that happened when SNMP monitoring was enabled. Download the updated firmware from [www.boschsecurity.com](http://www.boschsecurity.com).

**Notice!****Do not use the PRA-IM16C8 with the 1.81 software version.****3.8****Release 1.71**

- The system controller can now connect to an increased number of devices. This improves the performance when starting systems with many call stations.

**3.9****Release 1.70**

- Implementation of a SIP/VoIP interface for telephone paging with live speech. A SIP extension number can be linked to a PRAESENSA call macro. It is possible to configure call priority, start and end chimes, and the destination of the call. Besides telephone paging, the SIP/VoIP function can be used as another interface for audio and control to PRAESENSA from 3<sup>rd</sup> party systems such as intercom, nurse call, and passenger information systems.
- Implementation of a lock function to protect a call station placed in public against unauthorized access. To gain access to the call station, the operator must enter a User number and a Pin code in the LCD. The call station will automatically lock out after the lock timer expires or when the user presses the logout button.

**3.10****Release 1.61**

- Support of static IP address allocation is now available in addition to DHCP and Link Local address allocation. The Network configurator facilitates the assignment of IP addresses to either DHCP or static IP mode. It is a separate PC-based software tool included in the release package available at [www.boschsecurity.com](http://www.boschsecurity.com).
- It is possible to assign up to 10 standby controllers to one duty controller. All system controllers must be in the same subnet. This feature is especially convenient for a large setup with multiple system controllers. If a connection between system controllers fails, they continue to operate as separate self-sufficient systems, within their locally connected audio zones and call stations.
- The bug where a keypad extension mismatch of a Call station was not always reported correctly was fixed.

### 3.11 Release 1.50

- Support of the multi-controller functionality to allow the installation of a PRAESENSA system with multiple subsystems, each with its own system controller. Every additional system controller expands the system scalability. All subsystems are self-contained as they can operate independent of the other subsystems. The subsystems can also operate as a single large system under the control of a master or a superordinate system. In a multi-controller system, it is possible to make calls from the master system to the subsystems. For emergency purposes, the multi-controller system operates as a single large system: The emergency state and the fault state are propagated from subsystem to master and from master to subsystem. This feature complies with emergency standards, but it is not compliant with DNV-GL Type Approval.
- Support of the licensing mechanism to enable multi-controller systems, as well as other future functionalities.
- OMNEO platform upgrade to enable multi-VLAN support for PRAESENSA. PRAESENSA can now be installed in networks that are divided by a router in multiple sub networks.
- Support of OMN-ARNIE and OMN-ARNIS supervision. In case of redundant deployment, both the primary and the secondary devices are supervised. Multi-VLAN installations require the use of OMN-ARNIE devices to enable device discovery and audio clock synchronization.
- Switch supervision based on secure SNMP V3: The Cisco IE-5000-12S12P-10G router/switch and the PRA-ES8P2S (software version 1.01.06 or higher) are part of the network supervision to be able to detect defective or redundant network connections. The switches are supervised for presence and power supply.
- Support of the single press push-to-talk button (PTT) for a business call station: A call station in sleep mode is activated with the first press of the PTT button. The call starts immediately. This feature is especially convenient when no extension keypad is connected and a handheld microphone is in use.
- The bug fix that a battery leakage fault could not be reset after disconnecting the battery was resolved.
- High audio level on amplifiers no longer leads to audio interruptions due to false positives in the 100 V line supervision.

### 3.12 Release 1.42

- A potential weak point in the audio path supervision has been fixed. In rare cases, it could happen that an Amplifier channel fault (caused by a broken H-bridge MOSFET) was not detected.
- A bug fix has been implemented to resolve the issue that in some cases a System controller watchdog reset occurred while making a call on a Zone where volume was controlled by an Ambient Noise Sensor.
- In accordance with the North American standard for Mass Notification Systems, the software language set of English (UL 2572) has been revised and expanded in UL 2572 terminology.
- The Call station indicator test has been extended to the LCD display, in cadence with the microphone LED ring, the display will show the identical colors.

### 3.13

#### Release 1.41

- A bug fix has been implemented to resolve the issue that under certain conditions an “Amplifier channel fault” with “Severity: High” got the status “resolved” when on the same amplifier channel a fault occurred with “Severity: low” priority.
- For compliance to the Chinese GB16806 standard the translation of “EOL fault” into Simplified Chinese language was changed to a translation in standard-compliant terminology.
- A bug fix has been implemented to solve an issue that appeared when Background music was muted. When automatic volume control was configured in combination with BGM there was a possibility that when BGM was muted, amplifiers started to disconnect/connect to the system.
- A bug was fixed that in rare cases a high priority call stopped all running calls that were playing a message in the start chime phase.

### 3.14

#### Release 1.40

- Support for the new PRA-ANS Ambient noise sensor. The unit monitors changing ambient noise levels for automatic adjustment of announcement or background music levels (AVC - Automatic Volume Control). This insures the public address audio is set at a configurable level above the ambient noise in order to guarantee intelligibility of announcements, yet at a comfortable level. Upon failure or disconnection of the device, the announcement volume of the subscribing amplifier channels is automatically set to its maximum within the applicable control range.
- Support for the PRA-CSBK Call station kit, basic, which will be available by November 2021. The Call station kit, basic is an open frame call station to create dedicated, fully customized control panels with a CAN bus interface.
- Make announcement with zone selection is now available as an additional function for extension buttons. This function can be assigned to buttons and is similar to the Make announcement function, but without the pre-configured zone / zone groups selection. Using the Make announcement with zone selection function, a pre-recorded message, based on a call definition, can be started aborted/stopped in one or more manual selected zones / zone groups.
- Zones and zone groups can now be configured to the call station’s Push-To-Talk button to make live announcements without connecting to a call station extension. It simplifies the handling of basic calls that are always going to the same zone or zone group. Zone selection from a Call station extension can be done in parallel.
- Traditional Chinese is available and added to the language selection for the Graphic user interface of the PRA-CSLx.
- Functionality is added in preparation for certification to the North American standard for mass notification systems:
  - English (UL2572) is available for language selection. This language selection is used for mass notification systems and will set Configuration software and Graphic user interface of the PRA-CSLx to a specific English, that complies to UL terminology.
  - For each device a check box is added to General setting, which is set to Emergency relevant on default. Troubles (faults) that occur on devices that have assigned Emergency relevant will reported as Mass notification system faults.

- Class Mass notification is a new option in General settings of PRA-CSLx. Class Mass notification let the Call station act as a First responder panel for Mass Notification Systems (MNS). Emergency group is a new set of functionality, that allows multiple first responders (fire fighters) to control the evacuation of a building from multiple locations in which each has, one or more, First responder panel(s) (FRP's) in use.
- Transfer of control is a new function, that is only available when Class: Mass notification and Emergency group are set. In order to avoid confusion among the first responders (fire fighters), actions are only possible on one First responder panel at the time. That First responder panel is then 'in control'. It is possible to force the 'in control' state and to grant or deny a request.
- A bug fix was implemented to resolve the problem causing false positives on the amplifier fan supervision.

### 3.15

#### Release 1.20

- An important bug fix has been implemented. A Call station may lose its state when going through a reset. When a high priority call was started from this Call station before the reset and the call is configured as a continued call, it might have the consequence that it is impossible to stop the continued call or to change to other emergency calls during an evacuation. Users of the previous 1.00 and 1.10 software release must upgrade!
- The configuration webpages are available in additional languages: Czech, German, Spanish, English, French, Italian, Dutch, Korean, Polish, Portuguese, Russian, Slovakian, simplified Chinese.
- UL amplifier mode is added to system settings. When the amplifiers run in this mode, they comply to the requirements of UL with regards to temperature limitations.
- In a system with System controller redundancy, the Dante audio routing for inputs and/or outputs is synchronized with the redundant System controller. The Dante audio routing is configured for the duty System controller. As soon as the backup System controller takes over the Dante audio routing is automatically recreated.
- Fixes have been applied to the following security vulnerabilities of the configuration web interface. These changes only affect the web interface which is only used during configuration of the system:
  - In the web configuration of the System controller a Cross-Site Request Forgery (CSRF) vulnerability has been found. This has been solved by adding verification data to the web pages.
  - In the web configuration of the System controller a Cross-site Scripting (XSS) vulnerability has been found. This has been solved by sanitizing the data that is received from the web pages better to avoid that script data is fed back to the browser.
  - Additional HTTP headers are added to the web pages giving instructions to the browser in helping to avoid cross-site attacks.

### 3.16

#### Release 1.10

- Support of PRA-AD604 4-channel, 600 W amplifier.
- System controller redundancy.
- Fault simulation of an amplifier channel to force amplifier to spare channel.
- Dimming of Call station LCD and LEDs.

- Configurable audio delay for every amplifier channel.

## 4 Notices

System characteristics that are normal and intended, but possibly not expected.

### 4.1 Documentation and software download

Multi-lingual PRAESENSA product documentation and software is available from [www.boschsecurity.com](http://www.boschsecurity.com) > PRAESENSA product section. An additional download area for PRAESENSA software and English documentation is here: <https://licensing.boschsecurity.com/publicaddress>.

### 4.2 Software update

If an updated configuration was created with a newer software version, it should not be used on an older software version.

Always store and keep backups of the current configuration before upgrading.

### 4.3 Fault event - Temperature too high

If the amplifier detects temperature higher than +90 °C, the output level is attenuated by -3 dB in order to counteract this. The -3 dB attenuation is removed after the fault is acknowledged and reset. Before the fault can be cleared the temperature needs to drop below +80 °C.

### 4.4 Load measurement

The amplifier loudspeaker load measurement is part of the configuration (Diagnose > Amplifier loads). It is an essential step in the system configuration to do a load measurement to check whether the amplifier channels and the amplifier are not overloaded. Without this check, the amplifier channel volume is automatically set to -12 dB to protect the amplifier from unexpected overload conditions in case of an alarm situation.

### 4.5 Audio equalizer

The DSP audio equalizers have an internal headroom of 18 dB. Do not use audio equalizer settings with an accumulated gain of more than 18 dB at any frequency, as this will cause audio clipping for full scale input signals. It is good practice to do most of the frequency response corrections by attenuation of prominent frequency bands.

### 4.6 Minimum message length

The minimum message length for repeating messages is 500 ms.

### 4.7 Logging server compatibility

In release 1.10 the Open Interface of the System controller was updated, incompatible with the Logging Server of release 1.00. To continue receiving diagnostic events from the System controller, the Logging Server with the Open Interface .NET library must be updated to release 1.10.

### 4.8 System controller redundancy configuration

When a second System controller is added to a system for redundancy, the second System controller must be reset to factory default.



## 4.9 **Brightness adjustment**

The brightness adjustment of the PRA-CSLD and PRA-CSLW LCD and PRA-CSE LEDs is only supported on devices with HW version 01/01 and higher.

## 4.10 **Network snapshot**

A new network snapshot is required after a device is added, removed or replaced.

A system with redundant cabling and network supervision enabled requires a new network snapshot after a device is added, removed or replaced.

As long as a new network snapshot is not taken, a fault in the new device will not be reported.

## 4.11 **Multi-VLAN**

In systems with VLANs in combination with the OMN-ARNIE and the OMN-ARNIS, the lifeline between an amplifier and an PRA-MPS3 only works if both devices are part of the same subsystem.

## 4.12 **Multiple redundant system controllers**

Each standby system controller can take up to five minutes to synchronize with the duty controller. The synchronization is sequential, one standby system controller after the other. When the recorded message storage of the duty system is at full capacity, the maximum time per standby system controller is five minutes.

Do not disturb the network during the period of synchronization. Make sure the duty controller remains operational until all standby controllers have finished synchronizing. If local conditions allow, check the Link LEDs of all standby controllers:

- Yellow: the standby controller is not yet synchronized.
- Blue: the synchronization is over and the controller is ready.

## 4.13 **Static IP in fail-safe mode**

When a system controller or a power amplifier switches to fail-safe mode, its static IP-address is set to a DHCP or a link-local address.

If necessary, use the PRAESENSA Network Configurator to check the network mode and return it to a static IP.

## 4.14 **ARNI V8.41**

In a life safety system, version 1.61 of PRAESENSA cannot be used in combination with an 8.41 or early versions of the OMN-ARNIE/OMN-ARNIS devices.

## 4.15 **License for Multi-controller functionality**

One PRA-LSPRA License for PRAESENSA subsystems is required per subsystem. Contact Bosch to request the license.

## 5 Known limitations

System functions that are implemented but with limitations. In some cases workarounds are given.

### 5.1 Firmware upload to call station fails

The MTU (Maximum Transmission Unit) of the call stations is 1468. When the MTU of the PC network adapter that is used is set to a lower value than 1472 (1468 + 4), the data packets are split across different frames; the FWUT (Firmware Upload Tool) cannot handle this and will disconnect.

Check the actual MTU value of the network adapter by opening a **cmd**-window (with administrator rights) and enter:

```
netsh interface ipv4 show subinterface
```

If the MTU value is too low, it can be increased temporarily to a higher value by entering:

```
netsh interface ipv4 set subinterface
```

```
"<name of interface>" mtu=1500
```

```
store=persistent
```

Then try again.

### 5.2 Dante connections

Some Dante devices do not automatically re-establish their connection with the system controller after a reboot of the system controller. Re-establish the connection via Dante controller or use a Dante device that supports automatic reconnection.

### 5.3 Dante multicast

Only use Dante unicast streams between a Dante device and the system controller to prevent multicast addressing conflicts, that can result in audio distortion or not being able to setup a call.

### 5.4 Scheduled calls

If a scheduled call is activated by a button of a call station extension, the scheduled time intervals are ignored and the call starts immediately. Scheduled calls can only be started from a control input.

### 5.5 Load measurement

When a load measurement on an amplifier channel is done with a shorted loudspeaker line, the web page will indicate: "Not measured". Remove the short circuit and redo the load measurement.

### 5.6 Firmware upgrade

Before using the firmware upgrade tool, make sure the released PRAESENSA firmware files have been installed also.

In some rare cases the upgrade of a device will not be successful in the first attempt. If this occurs please retry for the device for which it failed.

## 5.7 Call station reset to factory default

A new Call station (PRA-CSLD or PRA-CSLW) out of factory first needs a firmware update before it can be reset to the factory default settings.

## 5.8 Enable Network Time Protocol (NTP)

NTP is configured on the “Time settings” page. Enable “Set time automatically (NTP)” and press submit. Wait for the reboot system page; this will take a few seconds. Press “System reboot” to activate NTP. If you navigate away to another configuration page too early and don’t wait for the reboot system page, a non-responsive web page will show "Loading" and NTP will remain disabled.

## 5.9 Audio missing on systems with multiple subnets

In systems with multiple subnets and systems controllers with release 1.42, it is possible to have live paging from a call station while chimes, recorded messages and Dante audio channels from the system controller are missing.

To solve the problem of the missing audio signals:

1. Update the system to software version 1.50 or higher.
2. Do a backup of the configuration to restore it afterwards.
  - As of release 2.20, the backup can include the recorded messages. If the software version is below 2.20, make sure to save the recorded messages so that they are uploaded again after restoring the configuration.
3. Perform a factory reset of the system controller.

## 5.10 Dante audio outputs

A system with System controller redundancy does not support secure Dante 4-digit PIN (Personal Identification Number) on the Dante audio outputs.

You might want to use Dante audio outputs to interface with 3<sup>rd</sup> party devices like amplifiers or devices for recording purposes. When control is switched from duty system controller to redundant System controller, the transmit of the Dante output channels of the duty system controller is moved to the redundant System controller in order to make the Dante audio outputs redundant.

The persistent Dante audio channels cannot be authenticated and not encrypted, so they form a security risk, as no precautions are taken against malicious or accidental attacks via their network interfaces. For highest security, these Dante output channels in combination with System controller redundancy must not be used as part of the PRAESENSA system.

## 5.11 DHCP server starts later in the system

If a DHCP server is not available when the system starts, but becomes available afterwards, the devices that started earlier use a link-local IP-address while the devices that started later can have a DHCP IP-address. These two groups of devices cannot communicate because they are in different subnets.

This is a temporary situation, since the devices with a link-local IP-address receive a DHCP IP-address later. However, the late connection of some devices can cause instability in the system.

To prevent this instability, it is recommended to have the DHCP server ready before the system starts.

If a DHCP server is never available, all devices keep link-local IP-addresses and the system remains stable.

## 5.12 Sticky faults

Sticky faults might occur in a system with a Cisco IE-5000-12S12P-10G switch. Take a new network snapshot to solve it.

This might happen after a restart of an ARNI device or of the Cisco switch itself.

## 5.13 Multi-subnet

Before using a PRAESENSA system on multiple VLAN, contact Bosch support.

## 5.14 Firmware upload of CST and PRA-ANS with static IP-addresses

A firmware upload of the PRA-CSLx Call stations and PRA-ANS Ambient noise sensors produced with firmware prior to V1.60 will fail if the devices are set to static IP.

For every firmware upload of these devices, you must:

1. Change the static IP-addresses of the devices to a DHCP- or link-local address.
2. Update the devices to the new software version.
  - You can now change the DHCP-addresses to static IP-addresses.

## 5.15 Network snapshot exceptions

As of software release 2.00, the network snapshot available in the **Network supervision** page does not detect:

- PRA-ANS Ambient noise sensors, and
- Certain PCs for configuration or PCs with customized configuration.

As such, even when these devices are connected to the network and working as expected, they are excluded from the downloadable snapshot.

## 5.16 Call stacking and time-shifting features

The following functions are not implemented with release 2.10:

- Listen to the announcements through the call station's internal loudspeaker before the public broadcast to the intended zones.
- Create temporary messages to playback afterwards.
- Create repeated calls from a single original announcement.

They will be implemented with future releases of the PRAESENSA software.

## 5.17 Limit of 4 digital audio flows for PRA-IM2A2

The PRA-IM2A2 has a maximum limit of four digital audio flows active at the same time. It is possible to configure two Dante inputs, two Dante outputs, or one Dante input and one Dante output.

When you select the **Audio mode Digital** for the audio interface module, two of the four digital audio flows are used to transfer the audio between the PRAESENSA system and the OMNEO network.

It is not possible to route more than one Dante flow with the Dante controller to one PRA-IM2A2 output. If you try to add a second Dante flow, that flow is automatically removed. From the Dante controller, do not route more than one Dante receiver to a PRA-IM2A2 Dante transmitter.

## 6 Security precautions

PRAESENSA is an IP-connected, networked Public Address and Voice Alarm system. To make sure that the intended functions of the system are not compromised, special attention and measures are required during installation and operation. The PRAESENSA configuration manual and installation manual provide many security measures related to the products and the activities described. This section provides an overview of precautions related to network security and access to the system.

- Follow the installation instructions with respect to the location of equipment and the permitted access levels. Refer to the chapter *Location of racks and enclosures* in the PRAESENSA installation manual for more information. Make sure to restrict access to call stations that address very large areas and to operator panels configured for alarm functions. To do so, mount them in an enclosure with a lockable door or configure user authentication on the device.
- It is highly recommended to operate PRAESENSA on its own dedicated network. Do not mix the system with equipment with other purposes. The extra equipment can be accessible by unauthorized people, causing a security risk. This is especially true if the network is connected to the Internet.
- It is highly recommended to lock or disable unused ports on network switches to avoid the possibility that connected equipment can compromise the system. This is also the case for PRAESENSA call stations connected through a single network cable. Make sure the connector cover of the device is in place and fixed to avoid access by a second network socket. Install other PRAESENSA equipment in an area that is only accessible by authorized people to avoid tampering.
- Use an Intrusion Protection System (IPS) with port security where possible to monitor the network for malicious activity or policy violations.
- PRAESENSA uses secure OMNEO for its network connections. All control and audio data exchange use encryption and authentication. But the system controller allows the configuration of unsecure Dante or AES67 audio connections as an extension of the system, both as inputs and as outputs. These Dante/AES67 connections are not authenticated and not encrypted. This forms a security risk, as no precautions are taken against malicious or accidental attacks through their network interfaces. For highest security, these Dante/AES67 devices should not be used as part of the PRAESENSA system. If you need such inputs or outputs, use unicast connections.
- The following switches report their power faults and network connection status directly to the PRAESENSA system controller through SNMP:
  - From PRAESENSA software version 1.50 onwards, the PRA-ES8P2S switch and the Cisco IE-5000-12S12P-10G switch/router.
  - From PRAESENSA software version 2.30 onwards, the Cisco IE-9320-22S4X-A switch/router.
  - The switches can be daisy-chained without an OMNEO device between them for connection supervision. The PRA-ES8P2S is preconfigured for this purpose from custom firmware version 1.01.05 onwards.
- For security reasons, the PRA-ES8P2S Ethernet switch is not accessible from the Internet by default. When the default (special link-local) IP-address is changed to an address outside the link-local range (169.254.x.x/16), the default (published) password must be changed. Even for applications on a closed local network, for highest security, the password must still be changed. Refer to the *Ethernet switch* chapter in the PRAESENSA installation manual for more information.

- To enable SNMP, for example to use the Bosch analysis tool Network Docent, use SNMPv3. SNMPv3 provides much better security with authentication and privacy. Select the authentication level SHA and encryption via AES. Refer to the *Ethernet switch* chapter in the PRAESENSA installation manual for more information.
- The system controller webserver uses secure HTTPS with SSL. The web server in the system controller uses a self-signed security certificate. When you access the server via https, you will see a Secure Connection Failed error or warning dialog indicating that the certificate was signed by an unknown authority. This is expected and to avoid this message in the future you have to create an exception in the browser.
- Make sure that new user accounts for system configuration access use sufficiently long and complex passwords. The user name must have a minimum of five characters and a maximum of 16 characters. The password must contain the characters as defined in the **System settings**. For more information, refer to the *System settings* chapter of the PRAESENSA configuration manual.
- The PRAESENSA system controller provides an Open Interface for external control. Access through this interface requires the same user accounts as for the system configuration access. In addition, the system controller generates a certificate to setup the TLS secure connection between the system controller and the Open Interface client. Download the certificate and open/install/save the crt-file. Activate the certificate on the client PC. Refer to the *System security* chapter in the PRAESENSA configuration manual for more information.
- System access to the devices of this system is secured via the OMNEO security user name and passphrase of the system. The system uses a self-generated user name and long passphrase. This can be changed in the configuration. The user name must have between 5 and 32 characters and the passphrase must have 8 to 64 characters. To update the firmware of the devices, the firmware upload tool requires this security user name and passphrase to get access.
- In case a PC for event logs is used (PRAESENSA logging server and viewer), make sure that the PC is not accessible by unauthorized persons.
- Use secure VoIP protocols (SIPs) whenever possible, including verification through VoIP server certificate. Only use non-secure protocols when the SIP server (PBX) does not support secure VoIP. Only use VoIP audio in the protected sections of the network, because the VoIP audio is not encrypted.
- Anyone with the ability to dial one of the extensions of the system controller can make an announcement in the PRAESENSA system. Do not allow external numbers to dial the system controller extensions.

Find all documentation and software related at [www.boschsecurity.com](http://www.boschsecurity.com) in the **Downloads** section of the PRAESENSA products.

Whenever you think you have identified a vulnerability or any other security issue related to a Bosch product or service, contact the Bosch Product Security Incident Response Team (PSIRT): <https://psirt.bosch.com>.

## 7 Support services and Bosch Academy



### Support

Access our **support services** at [www.boschsecurity.com/xc/en/support/](http://www.boschsecurity.com/xc/en/support/).

Bosch Security and Safety Systems offers support in these areas:

- [Apps & Tools](#)
- [Building Information Modeling](#)
- [Warranty](#)
- [Troubleshooting](#)
- [Repair & Exchange](#)
- [Product Security](#)



### Bosch Building Technologies Academy

Visit the Bosch Building Technologies Academy website and have access to **training courses**, **video tutorials** and **documents**: [www.boschsecurity.com/xc/en/support/training/](http://www.boschsecurity.com/xc/en/support/training/)

### PRAESENSA Downloads

For specific PRAESENSA content, refer to <https://licensing.boschsecurity.com/publicaddress>.









**Bosch Security Systems B.V.**

Torenallee 49

5617 BA Eindhoven

Netherlands

**[www.boschsecurity.com](http://www.boschsecurity.com)**

© Bosch Security Systems B.V., 2025

**Building solutions for a better life**

202503191553