

# TECHNICAL INFORMATION

## Intrusion

## ICP-CC488P, CC408P, CC404P

### PCB Modifications

December 19, 2008

#### Issue Severity:



**High:** Act immediately



**Medium:** Bosch Security Systems, Inc. strongly recommends you take the action(s) described below.




**Low:** Advisory

#### Products Affected:

- Solution ICP-CC488P
- Solution ICP-CC408P
- Solution ICP-CC404P

This version of the Solution ICP-CC488P, ICP-CC408P, or ICP-CC404P Control Panel Printed Circuit Board (PCB) is modified when compared to earlier versions. Make sure you pay attention to the modifications when creating your PCB connections. The PCB modifications are described below:

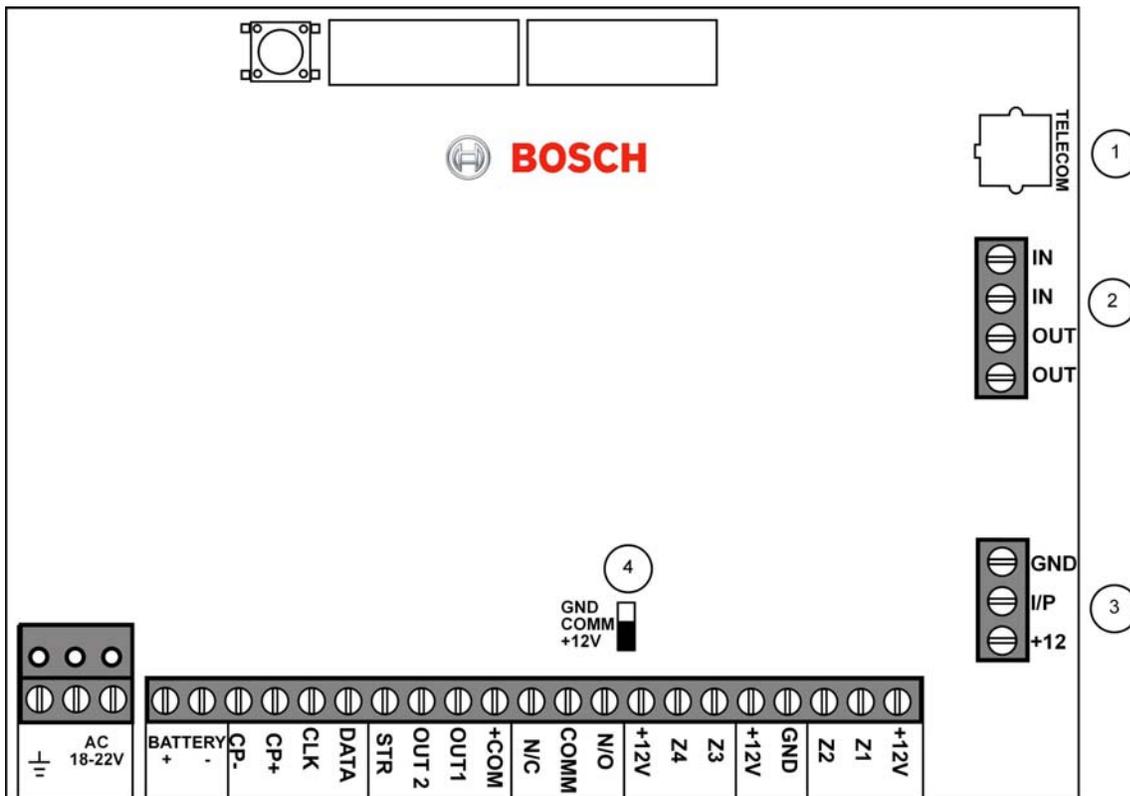

- TELECOM connector (Item 1): This connector is in a new location on the PCB.
- TELECOM terminal block (Item 2): This terminal block is in a new location on the PCB.
- Receiver Interface terminal block (Item 3): This terminal block is in a new location on the PCB, and the terminals are reversed when compared to earlier PCBs. This terminal block is available only on the ICP-CC488P Control Panel PCBs.
- Relay Contact connector (Item 4): This connector is in a new location on the PCB, and the terminals are reversed when compared to earlier PCBs.

